








SPD910

Installation

Differential pressure, vacuum, overpressure switch
Differens-, vakuum-, övertryckströmställare
Differenz-, Vakuum-, Überdruckwächter
Manostat pour pression différentielle, depression et surpression
Interrupitor de diferencia, vacío, hiperpresion
Interruttore differenziale per vuoto e sovrappresione

Instruction
Montageanvisning
Bedienungsanleitung
Instructions d'installation
Instrucciones de empleo
Istruzioni per installazioni

Schneider
Electric

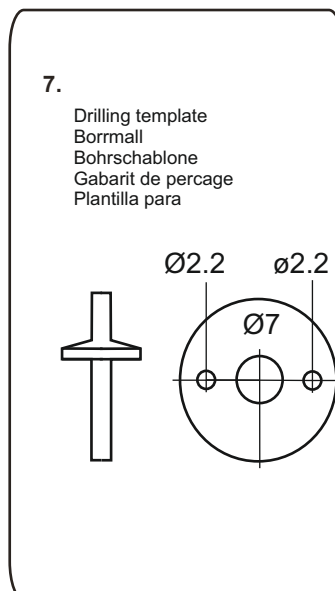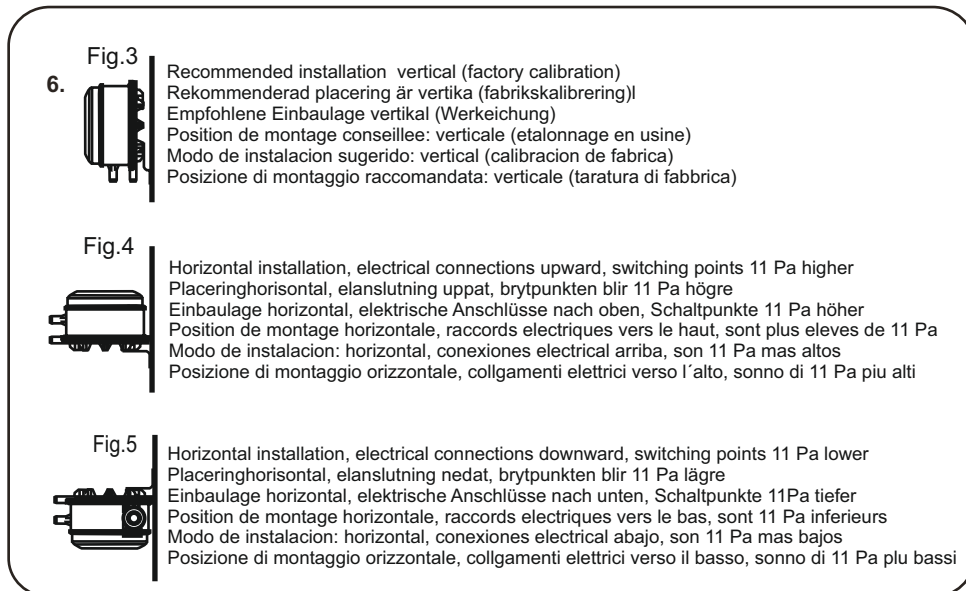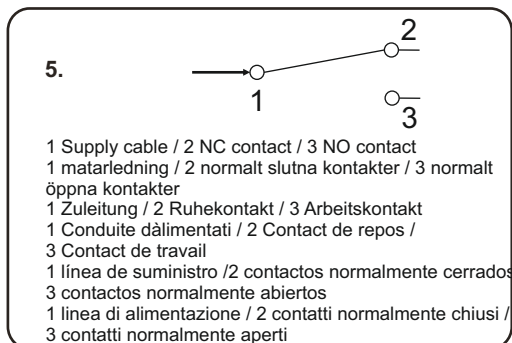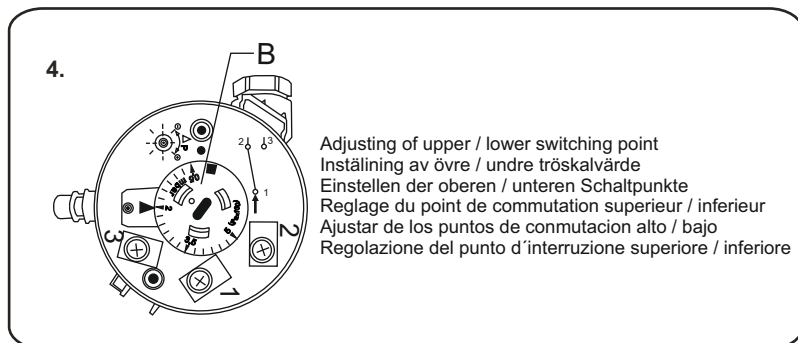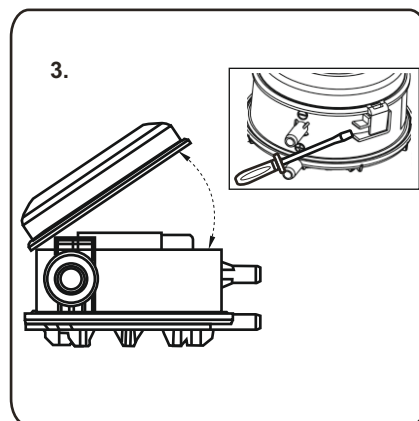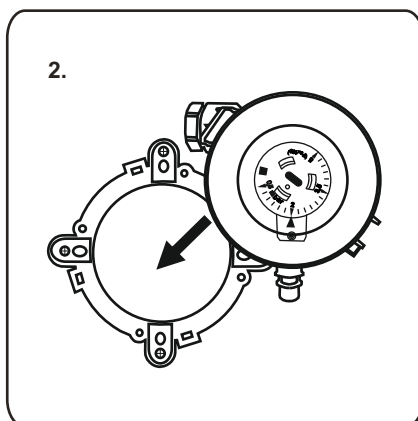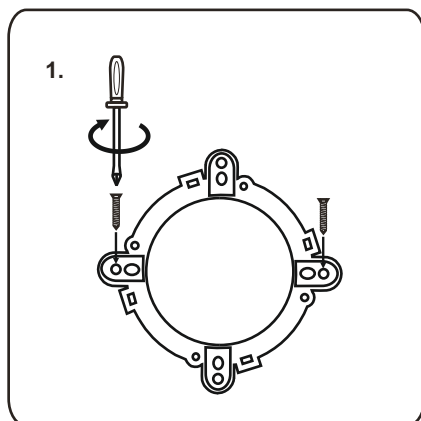

Note ⚡
With the safety cover removed, contact with terminals 1, 2 and 3 poses a lethal C hazard (mains power voltage)!

Varning ⚡
Efter att skyddsskapan har avlägsnats består livsfara vid berörande av klämmorna 1, 2 och 3 (nätspänning)!

Achtung ⚡
Nach Entfernen der Schutzhaube (A) besteht Lebensgefahr beim Berühren der Klemmen 1, 2 und 3 (Netzspannung)!

Attention ⚡
Après avoir enlevé le capot de protection, il y a danger de mort à toucher les bornes 1, 2 et 3 (tension de secteur)!

Atencion ⚡
Peligro mortal despues de quitar la capota protectora (A) si se tocan los bornes 1, 2, y 3 (tension de red)

Attenzione ⚡
Dopo aver asportato la calotta di protezione sussiste pericolodi morte al contatto con i morsetti 1, 2 e 3 (tensione di rete)!

Note!
Do not turn the dial (B) into the area of the black mark!

Varning!
Vrid inte inställningsskivan (B) ända till den svarta markeringen!

Achtung!
Dreh Scheibe (B) nicht in den Bereich des schwarzen Balkens drehen!

Attention!
Ne pas tourner le disque (B) dans la zone du repere noir!

Atencion!
No girar el disc rotatorio hacia dentro de la faja negra.

Attenzione!
Non girare il disco (B) nella zona della barra nera!

SPD910

Installation



Differential pressure, vacuum, overpressure switch
Differens-, vakuum-, övertryckströmställare
Differenz-, Vakuum-, Überdruckwächter
Manostat pour pression différentielle, depression et surpression
Interruptor de diferencia, vacío, hiperpresion
Interruttore differenziale per vuoto e sovrappresione

Instruction
Montageanvisning
Bedienungsanleitung
Instructions d'installation
Instrucciones de empleo
Istruzioni per installazioni



部件名称 Part Name	有害物 - Hazardous Substances					
	(Pb)	汞 (Hg)	(Cd)	六价 (Cr (VI))	多溴 苯 (PBB)	多溴二苯醚 (PBDE)
金属部件 Metal parts	X	O	O	O	O	O
塑料部件 Plastic parts	O	O	O	O	O	O
子件 Electronic	O	O	O	O	O	O
触点 Contacts	O	O	O	O	O	O
和 附件 Cables & cabling accessories	O	O	O	O	O	O
本表格依据SJ/T11364的 定 制。 O: 表示 有害物 在 部件所有均 材料中的含量均在GB/T 26572 定的限量要求以下。 X: 表示 有害物 至少在 部件的某一均 材料中的含量超出GB/T 26572 定的限量要求。 (企 可在此处, 根据实 情况对上表中打的技术原因 行 一步 明。)						
This table is made according to SJ/T 11364. O: indicates that the concentration of hazardous substance in all of the homogeneous materials for this part is below the limit as stipulated in GB/T 26572. X: indicates that concentration of hazardous substance in at least one of the homogeneous materials used for this part is above the limit as stipulated in GB/T 26572						